

LAND CORNER RECORD

XX


Index: P-13	Corner: Quarter corner common to Section 21 and Section 22	State of Indiana - Hoosier National Forest
Section: 21	Township: 7N Range: 1E P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1376925.50 Lon./E: 3145259.59	Datum: NAD83(2011) US survey feet


CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:	Surveyor:	Monument:	Recording Information:		Monument Photograph:
11/10/1880	Monroe County Surveyor	Post	Legal Survey Book 2, Page 328		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:	
	White Oak	12"	S72°W	27 Links	
	White Oak	14"	S40°E	20 Links	
Record evidence of prior survey:					
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:		
Undated	Steven Farkas Monroe Co. Surveyor	Steel pipe with cap	Monroe Co. Surveyor Monument Record		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:	
	Tulip Poplar	30"	N05°E	41.4'	
	Tulip Poplar	4"	S10°E	6.35'	
	Black Oak	30"	N60°W	38.90'	
Record evidence of prior survey:	Found pipe with cap.				

ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Mag nail in Tulip Poplar	10"	N86°E	14.35'
	Concrete ROW marker	N/A	N11°E	1.5'
	Mag nail set in White Oak	15"	S86°W	24.28'
	Wood USFS Post	4"x4"	S90°E	2.2'
Monument Found or Set:	Found a 3 inch galvanized pipe with a brass cap 0.5' above grade.			

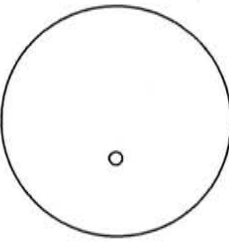MONUMENT SKETCH	NARRATIVE REFERENCE:
	Monument is a 3 inch galvanized pipe with a brass cap 0.5' above grade, a carsonite post is located 1.35' SW of the monument. Located approximately 150' East of Center Line of State Road 446, approximately 25' East from North/South running tree line, South slope of East/West running ridge.

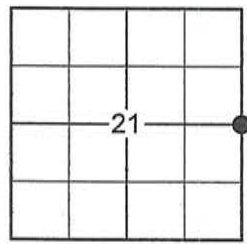SECTION DIAGRAM	PERPETUATION RECORD:
 Corner Location = ●	This monument was set by the USFS as shown on an unsigned USFS survey (c.1980) showing a breakdown of Section 21 (on file in the USFS office), the c.1980 USFS survey of the Southeast Quarter of Section 21 (on file in the USFS office), and is shown on the hand drawn sketch of Section 21 by Ken Anderson, dated 11-23-1982 (on file in the USFS office). This monument is at the midpoint of a line from the pipe found at R-13 (Section Corner common to Sections 21, 22, 27, & 28) and the pipe found at N-13 (Section Corner common to Sections 15, 16, 21, & 22). The record monument was found undisturbed and maintained by establishing two new bearing trees, and one concrete Right-of-Way monument as a reference. Bearing Trees were marked with a blaze, scribed B.T., bearing tree sign, paint, and nail where permission was granted by adjoining landowner.
Section: 21 T7N R1E	Prepared By: BRG (Project#3-565) Date: 6/2015

Referenced on BRG survey recorded as InstNo.2016001724

Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

CORNER I.D. #

POLK


M - 15

MONUMENT RECORD

STATE OF INDIANA ~ COUNTY OF MONROE

SECTION 22, TOWNSHIP 7 NORTH, RANGE 1 EAST

MONUMENT DESCRIPTION & REMARKS: STEEL PIPE WITH CAP FOUND AT 1/4
CORNER MARKING THE WEST 1/4 OF SECTION 22.

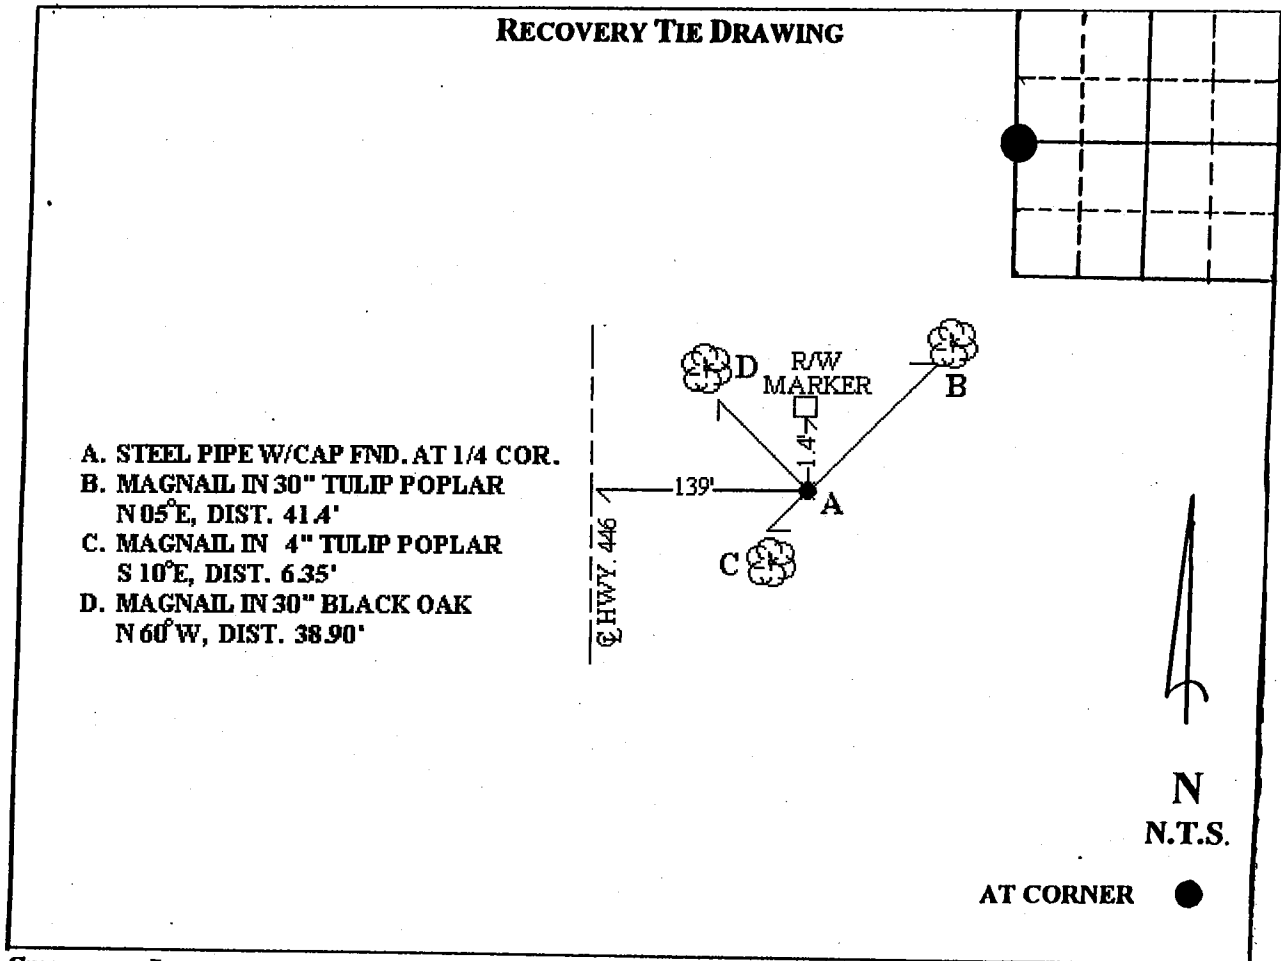

STATE OF INDIANA

COUNTY OF MONROE

I, STEVEN V. FARKAS, HEREBY CERTIFY THAT THIS DOCUMENT WAS
PREPARED UNDER MY DIRECTION IN ACCORDANCE WITH THE PROVISIONS OF SECTION
17-3-64-4 THROUGH 17-3-64-8 OF THE INDIANA CODE, BEING ACTS OF 1965, CHAPTER 319;
AND THE ABOVE DATA IS GIVEN UNDER MY HAND AND SEAL
THIS _____ DAY OF _____, 200__ A.D.

INDIANA REGISTERED LAND SURVEYOR NO. _____ OR

UNITED STATES GOVERNMENT AGENCY

TITLE

FIELD BOOK: _____

PAGE: _____

DRAFT #: 111

MONUMENT RECORD


Corner I.D. #

m-15

STATE OF INDIANA - COUNTY OF MONROE

Section Twenty-two (22), Township 7 North, Range 1 East

Monument Description & Remarks: Found U.S.F.S. Monument solid in ground at West 1/4 corner of section. Monument was 3" Aluminum Cap set in 3" diameter Iron Pipe. No stamping on cap. County survey marker sign set on (continued)

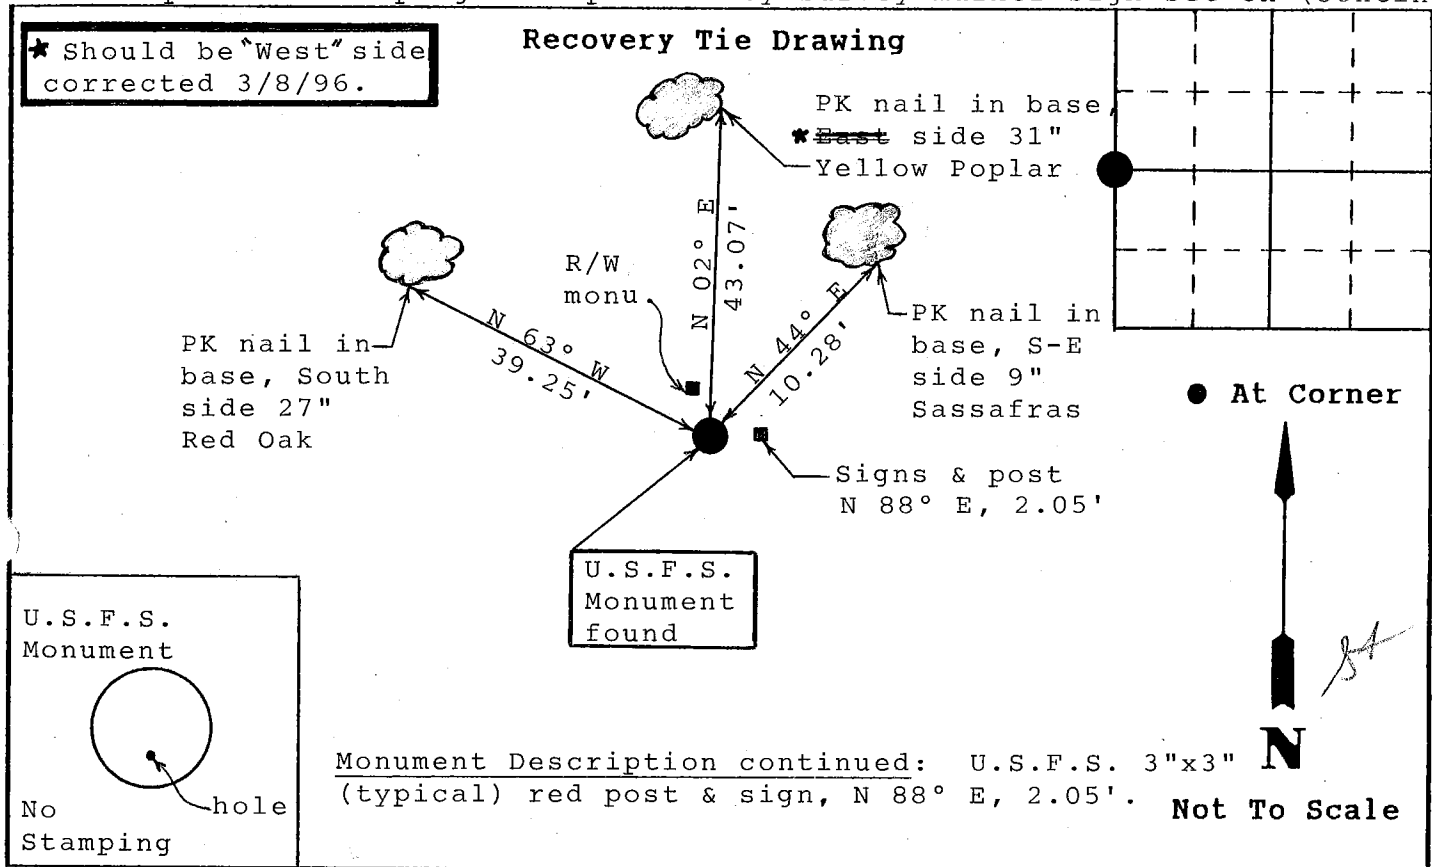

State of Indiana
County of Monroe

I, Michael W. Friley, County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 17-3-64-4 through 17-3-64-8 of the Indiana Code, being Acts of 1965, Chapter 319; and the above data is given under my hand and seal this 14th day of February, 1996 A.D.

Indiana Registered Land Surveyor No. _____ or

Monroe County Surveyor's Office

United States Government Agency

Monroe County Surveyor

Title

Space
Reserved For
Recording
Officer

Field Book:

96-01

Page:

20

Index No. P-13
(Alphabetical - Numerical)


LAND CORNER RECORD
(RECTANGULAR SURVEYS)

R9-7150-4 (Rev. 6/13/67)
GPO 806-924

T. 7N R. 1E Mer. N.F. Hoosier County Monroe State Ind.
1/4 Section Corner common to sections 21, 22, and _____

EXISTING SURVEYS

Original Government Survey		Original Evidence Found	
Year surveyed <u>1814</u>		Year of search _____	By _____
Original monument <u>Wood post</u> (Wood post, stone, pile of stones, pipe, etc.)		Monument found _____	
Bearing Trees		Original Bearing Trees Found	
Species <u>Dogwood</u> <u>chestnut</u>		Species _____	
Diameter <u>3"</u> <u>9"</u>		Diameter _____	
Bearing <u>N 57 E</u> <u>S 27 W</u>		Bearing _____	
Distance <u>2 lks</u> <u>17 lks</u>		Distance _____	
Subsequent Corner Restoration		Evidence of Subsequent Corner Restoration Found	
Year surveyed _____	By _____	Year of search _____	By _____
Where filed or recorded _____			
Monument _____ (Original, concrete post, iron rod, etc.)			
Bearing Trees, Reference Objects		Bearing Trees, Reference Objects	
Species _____			
Diameter _____			
Bearing _____			
Distance _____			

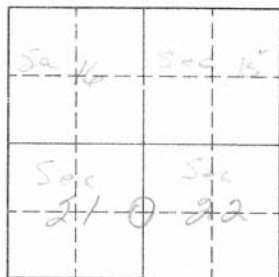

Sketch

○ Corner ☒ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____
Object _____
Record distance _____
Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. _____

Perpetuation Record

Monument and accessories established. Include brief description of area. _____

At time of search:

1. Did you have the record description?
Yes ☒ No _____

2. How was search area located?
Pacing, chaining, photos, maps,
etc. _____

3. Man hours spent in search 2 hrs.

4. Do you think additional search might
recover evidence? Yes _____ No ☒

5. Signature Nancy Dwyer

Certified corner restoration certificate prepared: Yes _____ No _____
Filed in county records at _____ Date _____ County Document No. _____
Identified on aerial photo No. _____ Which is filed at _____